

Issued on March 13, 2020.

**Gaetano A. Sciortino,**

*Deputy Director for Strategic Initiatives,  
Compliance & Airworthiness Division,  
Aircraft Certification Service.*

[FR Doc. 2020-05762 Filed 3-19-20; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2020-0201; Product Identifier 2020-NM-007-AD]

RIN 2120-AA64

### Airworthiness Directives; Airbus SAS Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus SAS Model A318-111, -112, -121, and -122 airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. This proposed AD was prompted by reports of fatigue cracks on continuity fittings at the lower framing of the front windshield on airplanes on which a certain production modification has been embodied. Additional analysis showed that certain certification requirements for damage tolerance and fatigue are not met on airplanes in a certain post-production modification configuration. This proposed AD would require repetitive high frequency eddy current (HFEC) inspections of the central node windshield area for cracking, and applicable corrective actions if cracking is found, as specified in a European Union Aviation Safety Agency (EASA) AD, which will be incorporated by reference. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by May 4, 2020.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-

30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For the material identified in this proposed AD that will be incorporated by reference (IBR), contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 1000; email [ADS@easa.europa.eu](mailto:ADS@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0201.

#### Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0201; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2020-0201; Product Identifier 2020-NM-007-AD" at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. The FAA will consider all comments received by the closing date and may amend this NPRM based on those comments.

The FAA will post all comments, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this NPRM.

*www.regulations.gov*, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this NPRM.

#### Discussion

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2020-0005, dated January 13, 2020 ("EASA AD 2020-0005") (also referred to as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Airbus SAS Model A318-111, -112, -121, and -122 airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -215, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. Model A320-215 airplanes are not certified by the FAA and are not included on the U.S. type certificate data sheet; this proposed AD therefore does not include those airplanes in the applicability.

This proposed AD was prompted by reports of fatigue cracks on continuity fittings at the lower framing of the front windshield on airplanes on which Airbus Production Modification 22058 (which is included in Airbus Modification 21999) has been embodied. Additional analysis showed that certain certification requirements for damage tolerance and fatigue are not met on airplanes in a post-production Modification 22058 configuration. The FAA is proposing this AD to address this condition, which could lead to failure of the continuity fittings at the lower node of the windshield central frame, possibly resulting in decompression of the airplane and injury to occupants. See the MCAI for additional background information.

#### Related IBR Material Under 1 CFR part 51

EASA AD 2020-0005 describes procedures for repetitive HFEC inspections of the central node windshield area for cracking, and applicable corrective actions if cracking is found. The corrective actions include modification or repair. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another

country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI referenced above. The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

#### Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in EASA AD 2020-0005 described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

#### Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA initially worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding

FAA ADs. The FAA has since coordinated with other manufacturers and civil aviation authorities (CAAs) to use this process. As a result, EASA AD 2020-0005 will be incorporated by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2020-0005 in its entirety, through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in the EASA AD does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in the EASA AD. Service information specified in EASA AD 2020-0005 that is required for compliance with EASA AD 2020-0005 will be available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0201 after the FAA final rule is published.

#### Explanation of Note 1 of EASA AD 2020-0005

Note 1 of EASA AD 2020-0005 states that, for certain airplanes, no further action is required by that AD up to the "Publication Trigger." The "Publication Trigger" is the operation limit for the affected airplanes, which is specified in the Airbus A318/A319/A320/A321 Airworthiness Limitations Section (ALS) Part 2-Damage Tolerant Airworthiness Limitation Items (DT-ALI), Revision 07, dated June 13, 2018, (which is mandated by AD 2019-23-01, Amendment 39-19794 (84 FR 66579, December 5, 2019)). Airbus A318/A319/A320/A321 Airworthiness Limitations Section (ALS) Part 2-Damage Tolerant Airworthiness Limitation Items (DT-ALI), Revision 07, dated June 13, 2018, requires operators to contact Airbus for further instructions before they exceed the operation limit referenced as "Publication Trigger."

#### Costs of Compliance

The FAA estimates that this proposed AD affects 1,203 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

#### ESTIMATED COSTS FOR REQUIRED ACTIONS \*

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
19 work-hours × \$85 per hour = \$1,615 .....	\$0	\$1,615	\$1,942,845

\* Table does not include estimated costs for reporting.

The FAA estimates that it would take about 1 work-hour per product to comply with the proposed reporting requirement in this proposed AD. The average labor rate is \$85 per hour. Based on these figures, the FAA estimates the

cost of reporting the inspection results on U.S. operators to be \$102,255, or \$85 per product.

The FAA estimates the following costs to do any necessary on-condition modifications that would be required

based on the results of any required actions. The FAA has no way of determining the number of aircraft that might need these on-condition modifications:

#### ESTIMATED COSTS OF ON-CONDITION MODIFICATIONS \*

Labor cost	Parts cost	Cost per product
1,122 work-hours × \$85 per hour = \$95,370 .....	\$316,043	\$411,413

\* The FAA has received no definitive data that would enable the agency to provide cost estimates for the on-condition repairs specified in this proposed AD.

#### Paperwork Reduction Act

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control

number for the collection of information required by this proposed AD is 2120-0056. The paperwork cost associated with this proposed AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this proposed AD is mandatory. Comments concerning

the accuracy of this burden and suggestions for reducing the burden should be directed to Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177-1524.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue

rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

## PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus SAS:** Docket No. FAA-2020-0201; Product Identifier 2020-NM-007-AD.

### (a) Comments Due Date

The FAA must receive comments by May 4, 2020.

### (b) Affected ADs

None.

### (c) Applicability

This AD applies to Airbus SAS Model airplanes specified in paragraphs (c)(1) through (4) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2020-0005, dated January 13, 2020 ("EASA AD 2020-0005").

(1) Model A318-111, -112, -121, and -122 airplanes.

(2) Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes.

(3) Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes.

(4) Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes.

### (d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

### (e) Reason

This AD was prompted by reports of fatigue cracks on continuity fittings at the lower framing of the front windshield on airplanes on which Airbus Production Modification 22058 (which is included in Airbus Modification 21999) has been embodied. Additional analysis showed that certain certification requirements for damage tolerance and fatigue are not met on airplanes in a post-production Modification 22058 configuration. The FAA is issuing this AD to address this condition, which could lead to failure of the continuity fittings at the lower node of the windshield central frame, possibly resulting in decompression of the airplane and injury to occupants.

### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

### (g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2020-0005.

### (h) Exceptions to EASA AD 2020-0005

(1) Where EASA AD 2020-0005 refers to its effective date, this AD requires using the effective date of this AD.

(2) The "Remarks" section of EASA AD 2020-0005 does not apply to this AD.

(3) Paragraph (8) of EASA AD 2020-0005 specifies to report inspection results to Airbus within a certain compliance time. For this AD, report inspection results at the applicable time specified in paragraph (h)(3)(i) or (ii) of this AD.

(i) If the inspection was done on or after the effective date of this AD: Submit the report within 90 days after the inspection.

(ii) If the inspection was done before the effective date of this AD: Submit the report within 90 days after the effective date of this AD.

### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* For any service information referenced in EASA AD 2020-0005 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(4) *Paperwork Reduction Act Burden Statement:* A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. All responses to this collection of information are mandatory as required by this AD; the nature and extent of confidentiality to be provided, if any. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden to Information Collection Clearance Officer, Federal

Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177–1524.

#### (j) Related Information

(1) For information about EASA AD 2020–0005, contact the EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 89990 6017; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–0201.

(2) For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov).

Issued on March 10, 2020.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2020–05485 Filed 3–19–20; 8:45 am]

BILLING CODE 4910–13–P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2019–1113; Project Identifier MCAI–2019–00117–E]

RIN 2120–AA64

#### Airworthiness Directives; Austro Engine GmbH Engines

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for all Austro Engine GmbH model E4 and E4P diesel piston engines. This proposed AD was prompted by reports of considerable wear of the timing chain and failure of fuel injectors on these engines. This proposed AD would require replacement of the timing chain and fuel injectors on the affected Austro Engine GmbH model E4 and E4P diesel piston engines. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by May 4, 2020.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202 493 2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12 140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Austro Engine GmbH, Rudolf-Diesel-Strasse 11, A–2700 Weiner Neustadt, Austria; phone: +43 2622 23000; fax: +43 2622 23000–2711; website: [www.austroengine.at](http://www.austroengine.at). You may view this service information at the FAA, Engine and Propeller Standards Branch, 1200 District Avenue, Burlington, MA 01803. For information on the availability of this material at the FAA, call 781–238–7759.

#### Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2019–1113; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Mehdi Lamnyi, Aerospace Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803; phone: 781–238–7743; fax: 781–238–7199; email: [Mehdi.Lamnyi@faa.gov](mailto:Mehdi.Lamnyi@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2019–1113; Project Identifier MCAI–2019–00117–E” at the beginning of your comments. The FAA specifically invites comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. The FAA will consider all comments received by the closing date and may amend this NPRM because of those comments.

Except for Confidential Business Information as described in the

following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this NPRM.

#### Confidential Business Information

Confidential Business Information (CBI) is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Mehdi Lamnyi, Aerospace Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA 01803. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### Discussion

The European Union Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA AD 2019–0041, dated February 25, 2019 (referred to after this as “the MCAI”), to address the unsafe condition on these products. The MCAI states:

The airworthiness limitations and maintenance tasks for the Austro Engine E4 and E4P engines, which are approved by EASA, are currently defined and published in the Austro Engine MM, Chapter 04. These instructions have been identified as mandatory for continued airworthiness.

Failure to accomplish these instructions could result in an unsafe condition.

Austro Engine recently revised the ALS, introducing life limit for the engine timing chain and for the fuel injectors.

For the reason described above, this [EASA] AD requires accomplishment of the actions specified in the ALS.

You may obtain further information by examining the MCAI in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2019–1113.